

X20IF1072 导入 EDS 文件后一直报缺失

1、背景

自己电脑的工程拷贝到客户电脑后报 EDS 文件缺失，删除并重新导入后还是一样！


自己电脑配置：

电脑系统：win10

AS 版本：4.7.7.74

AR 版本：E4.73

硬件拓扑如下：使用 CP3585+IF1072 带 12 个汇川 SV660C 伺服

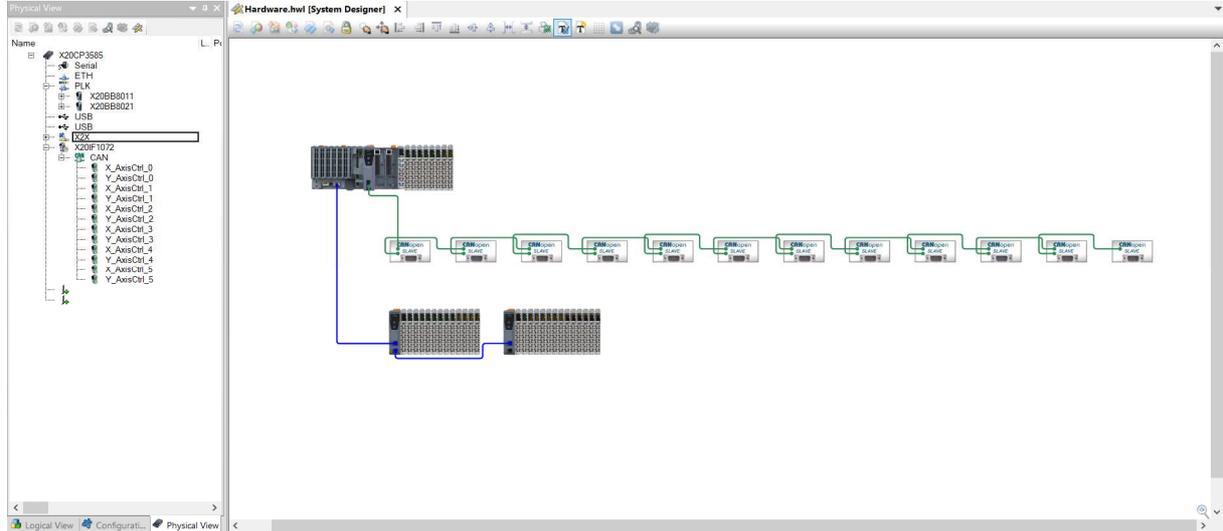

客户电脑配置：

电脑系统：win11

AS 版本：4.7.2.98

AR 版本：E4.73

2、问题

自己电脑的工程拷贝到客户电脑打开后报 EDS 文件缺失，具体如下图：

Output Results

#	Category	Date/Time	Description	Error	Position	File
22	Error	5/4/2023 11:50:02 1432 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.	4821	Ln: 808, Col: ...	D:\Desktop\HAJT\Tuhuo_TubeControl_20230504\Physical\Tuhuo_3585_SV660C_1072\Hardware F
24	Error	5/4/2023 11:50:02 1442 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.	4821	Ln: 849, Col: ...	D:\Desktop\HAJT\Tuhuo_TubeControl_20230504\Physical\Tuhuo_3585_SV660C_1072\Hardware F
26	Error	5/4/2023 11:50:04 1453 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
28	Error	5/4/2023 11:50:04 1460 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
30	Error	5/4/2023 11:50:04 1460 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
32	Error	5/4/2023 11:50:04 1470 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
34	Error	5/4/2023 11:50:04 1483 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
36	Error	5/4/2023 11:50:04 1496 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
38	Error	5/4/2023 11:50:04 1547 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
40	Error	5/4/2023 11:50:04 1557 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
42	Error	5/4/2023 11:50:04 1567 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
44	Error	5/4/2023 11:50:04 1577 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
46	Error	5/4/2023 11:50:04 1587 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			
48	Error	5/4/2023 11:50:04 1607 PM	Support for hardware module type FBC: 0a00000389 0a0000010c: SV660C_V1 is not available. Please install the corresponding upgrade.			

3、解决方法

在升级 AS 到相同版本，删除工程中该伺服 DTM 相关设备后重新导入 Fieldbus EDS 后即解决该问题。

